

TO: SERVICE MANAGER TECHNICIANS
PARTS MANAGER

▲ = Revised November 1996

No. 96-15

Required ECM Replacement

Models


- ▲ "A" MCM 7.4LX MPI Bravo Stern Drive Engines. Serial Number: 0F602086-0F801999.
"A" MIE 7.4L MPI Bluewater Inboard Engines. Serial Number: 0F622498-0F820103.
- ▲ "B" MCM 7.4LX MPI Bravo Stern Drive Engines. Serial Number: 0F802000-0K021173.
"B" MIE 7.4L MPI Bluewater Inboard Engines. Serial Number: 0F820104-0K144653.

Problem

The calibration programmed into the production ECM will not sound the Audio Warning Alarm until 311 °F (155 °C). This temperature is too high and will not warn the boat operator early enough if the engine starts to overheat.

Correction

- ▲ Look at the number on the white tag on the ECM. Refer to "A" or "B" under drawing.

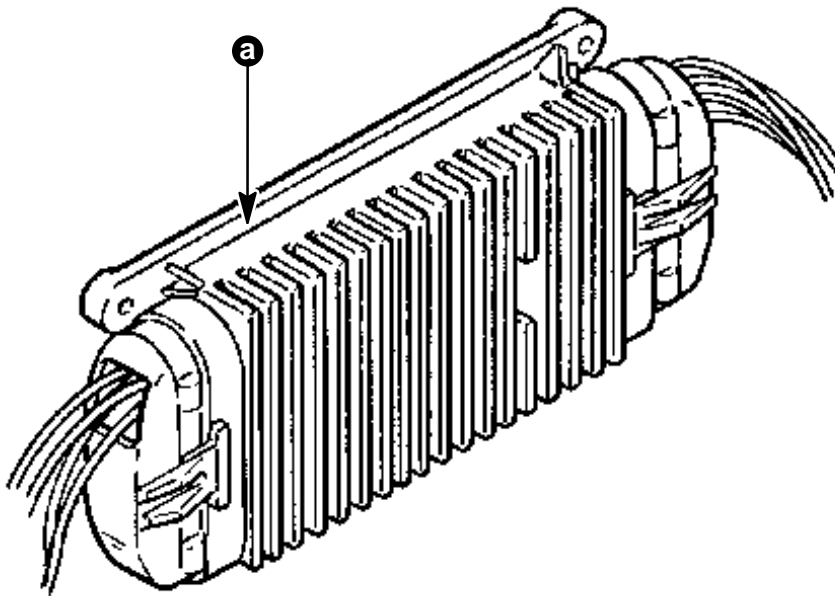

72801

- ▲ a - "A" Engines With Number 9629: DO NOT Change. Any Other Number, Change ECM.
"B" Engines With Number 9138: DO NOT Change. Any Other Number, Change ECM.

Part Required

▲ "A" Engines: Order (1) 807210T 5 Engine Control Module (ECM).

"B" Engines: Order (1) 807268T 3 Engine Control Module (ECM).

Warranty

Fill out warranty claim and send it to your normal warranty processing center. More than one engine can be put on the warranty claim if you list the part number, engine model, serial number, warranty code and labor hours for each engine on separate lines on warranty claim. Also, please put the number of hours running time for each ECM on warranty claim.

Warranty Code and Labor:

Replace ECM: MJ23 0.8 Hours

Old ECM: USA and Canada only: Return them along with warranty claim.

Other Countries: Contact your service center for instructions.