MERCURY Service bulletin

No. 2000-3

✓ WARRANTY INFORMATION

□ SERVICE INFORMATION

▲ = Revised September 2000. This bulletin supercedes the previous bulletin 2000-3.

Serpentine Belt Power Steering Pulleys

▲ Models

V6/V8 Sterndrive Engines, S/N 0K189152 - 0L002380

Situation

These engines have a plastic 4-3/4 in. (121 mm) diameter power steering pulley that could crack.

Inspection

Inspect the pulley, use a magnet or measure the diameter of the pulley. A metal, 5-3/4 in. (146 mm) diameter pulley is the correct pulley.

Correction

Replace the power steering pulley and serpentine belt with the correct Belt/Pulley Kit noted in Mercury MerCruiser Parts Bulletin 98-1.

Warranty

Fill out a warranty claim and send it to your normal warranty processing center. More than one engine can be put on the warranty claim if you list the part number, engine model, serial number, warranty code and labor hours for each engine on separate lines on warranty claim.

NOTE: The replacement of part(s) and labor under warranty, to the products outlined in this service bulletin, will expire February 2002.

Warranty Code and Labor:

MS20 0.5 Hour