

Service Bulletin

					Bulletin No. 2012-69 OEM No. 2012-67
Circulate to:	Sales Manager	Accounting	Service Manager	Technician	Parts Manager

Oetiker Ring Clamps from Mercury Marine

Models Affected

Models Covered	Serial Number
All Mercury Marine Product	All

Oetiker Ring Clamps from Mercury Marine

Inside Diameter mm	Part Number	Band Width mm
8.7	54-814200	5
12.5	54-889691	9
13.3	54-12999	8
13.5	54-888988023	7
14	54-850241	7
15.3	54-856880	7
15.7	54-13791	7
16.2	54-855697	7
16.8	54-898101237	8
18.5	54-888988022	7
19.8	54-848763	7
21	54-848764	7
22.6	54-888988019	7
25.5	54-8M0046568	7
25.6	54-855228	7
27.1	54-8M2000353	9
28.6	54-850896	7
30.8	54-8M6001924	7
31.6	54-8M0028753	7
32	54-863821	10
34.6	54-888988008	7
36.1	54-888988001	7
38.1	54-888988011	7
39.6	54-8M6000385	7


THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.


2012-69 NOVEMBER 2012 © 2012 Mercury Marine Page 1 / 3

Inside Diameter mm	Part Number	Band Width mm	
42.5	54-888988007	7	
43.5	54-863040	10	
45.5	54-8M6001459	7	
57.5	54-888988002	7	
59	54-888988006	7	
62	54-888988004	7	
63.5	54-888988025	7	
71	54-888988020	9	
75.5	54-888441	7	
77	54-888988021	9	
81.5	54-8M0012531	7	
84.5	54-888988026	7	
96.5	54-888988016	9 (0.6 mm band thickness)	
96.5	54-888988027	9 (0.8 mm band thickness)	

Oetiker Clamp Size Identification

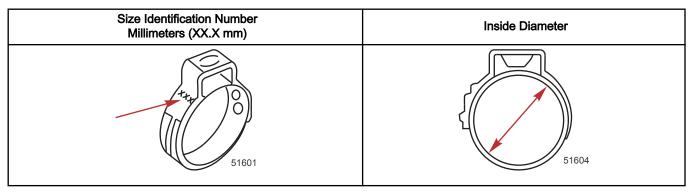

91-803146A04 Clamp Kit

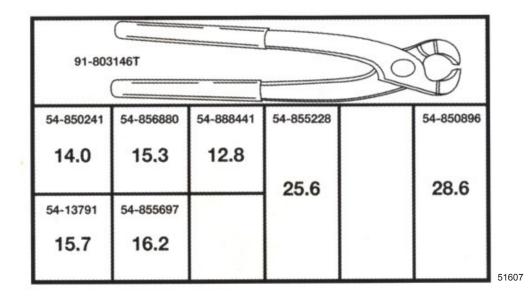


THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Page 2 / 3 © 2012 Mercury Marine NOVEMBER 2012 2012-69


Oetiker Ring Clamp Installation and Removal

INSTALLATION

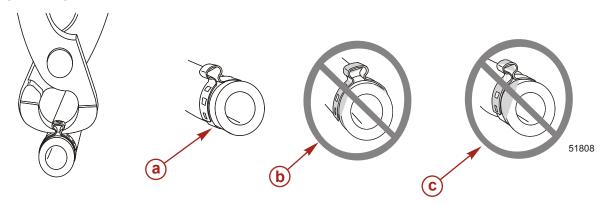

- a Correct
- **b** Too loose
- c Too tight

REMOVAL

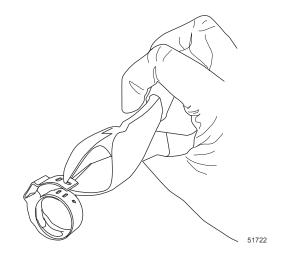

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.