

Service Bulletin

					Bulletin No. 2018-01R OEM No. 2018-01R
Circulate to:	Sales Manager	☐ Accounting	Service Manager	Technician	Parts Manager

5.0L Service Longblock Availability

NOTICE
NOTICE
Revised July 2018. This bulletin supersedes the previous bulletin number 2018-01 June 2018.

Models Affected

Description	Serial Number Or Year
5.0L GM Manufactured Replacement Longblock Assemblies	All

Scope

Worldwide

Situation

General Motors has ceased 5.0L longblock assembly production.

Engine Replacement Options

Mercury Marine offers several complete or partial engine replacement options to provide the best repower alternative for dealers and their customers.

- · Pending NLA 5.0L longblock
- Quicksilver Crate Engine
- · Plus Series Non-ECT Engine
- MerCruiser 4.5L and 6.2L Engine

IMPORTANT: It is the responsibility of the dealership and the installing technician to ensure the engine assembly that will be installed, does not adversely affect how the boat handles or the manufacturer's capacity plate specifications as it relates to: horsepower rating, or onboard weight capacity.

NOTE: Dual engines—Mercury Marine recommends the replacement of both engines in dual engine applications when a direct replacement engine of the same horsepower is not available.

NOTE: When replacing a 5.0L engine with a 5.7L engine model, more engine power will be available, and may have a different recommended RPM operating range. Therefore, it may be necessary to change the propeller pitch or the sterndrive gear ratio to ensure that the engine operates within the recommended RPM range. Allowing the engine not to operate within the recommended WOT RPM range, will reduce the expected life span of the engine or may cause engine damage. Damage caused from not operating the engine within the recommended WOT RPM range is not covered by the limited warranty.

Quicksilver crate engine alternates for the 5.0L longblock.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Pending NLA GM Longblock 5.0L	5.0L Fit Description	Quicksilver Crate Engine	Serial Number
	New 5.0L Longblock	350 Carbureted Alpha 300 HP 8M0079530	0L015751 and Up
8M0088396	Fits 1998–2015	350 Carbureted Bravo 325 HP 8M0079531	0L015751 and Up
01W10080390	New 5.0L Magnum MPI Longblock Fits 1998–2015	350 MPI Alpha and Bravo 300 HP 8M0092946	0M300000-0W309999
		350 MPI Alpha and Bravo 300 HP 8M0093550	0W310000 and Up

NOTE: DTS models require that the throttle body on the original engine be removed and installed onto the crate engine.

IMPORTANT: MPI replacement engines are not compatible with EFI or TBI engines. Options—order a carbureted model Quicksilver crate engine or repower with a Plus Series engine.

2. Plus Series non-ECT engine - refer to the current Repower Product Guide for detailed descriptions.

Remanufactured Plus Series Engines (Non-ECT)					
Horsepower	Liter Displacement	Drive Type	Part Number		
225	4.3 – four barrel	Alpha	865108R89		
275	5.7 – four barrel	Alpha	865108R88		
300	5.7 – MPI	Alpha	863611R11		
325	5.7 – four barrel	Bravo	865108R85		

100% New Quicksilver Engines (Non-ECT)				
Horsepower	Liter Displacement	Drive Type	Part Number	
300	5.7 – MPI	Alpha	8M0136293	
300	5.7 – MPI	Bravo	8M0136294	

^{3.} MerCruiser 4.5L and 6.2L engine - contact Mercury Marine for order assistance.

ECM/PCM Controllers for 350 MPI Quicksilver Crate Engines

To assist with the conversion of a 5.0L MPI to a 350 MPI Quicksilver crate engine, we are offering an ECM/PCM exchange program for MerCruiser applications.

Select the controller part number from the tables listed in the following pages and order from Mercury Marine or your parts distributor. If the engine serial number is not available on the existing engine, contact Mercury Marine Technical Service or your parts distributor for identification assistance. The cost of the controller will be credited by following the voucher process instructions on the PDI form and including the voucher with the returned parts.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Page 2 / 5 © 2018 Mercury Marine JULY 2018 2018-01R1

350 MPI 2002-2004

Crate Engine Description	Engine Part Number	Serial Number Range	ECM/PCM Type	ECM/PCM Part Number
		0M300000-0M599999	ECM-Alpha	865838T03
			ECM-Bravo	864377T06
			ECM-Alpha	865838T03
	4 8M0092946	0M600000-0W029410	ECM-Alpha FWC	865839T03
			ECM-Bravo	864377T06
350 MPI 2002–2004			ECM-Bravo FWC	865005T03
		0W029411–0W309999	ECM-Alpha	865838T03
			ECM-Alpha FWC	865839T03
			ECM-Bravo	865840T02
			ECM-Bravo FWC	865841T02

 $\hbox{THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE. } \\$

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

350 MPI Non-ECT 2005-2015

Crate Engine Description	Engine Part Number	Serial Number Range	ECM/PCM Type	ECM/PCM Part Number
			ECM-Alpha	866122T06
			ECM-Alpha FWC	866123T06
			ECM-Bravo	866124T06
		0W310000–0W649999	ECM-Bravo FWC	866125T06
			PCM DTS-Bravo	866238T04
			PCM DTS-Bravo FWC	866239T04
		0W650000-1A343327	ECM-Alpha	866122T05
	8M0093550		ECM-Alpha FWC	866123T05
			ECM-Bravo	866124T05
350 MPI			ECM-Bravo FWC	866125T05
2005–2015			PCM DTS-Bravo	866238T04
			PCM DTS-Bravo FWC	866239T04
			ECM-Alpha	879194T86
			ECM-Alpha FWC	879194T87
			ECM-Bravo	879194T88
			ECM-Bravo FWC	879194T89
		1A343328 and up	PCM DTS-Bravo	8M0059271
			PCM DTS-Bravo FWC	8M0059272
			PCM-Axius	879288T90
			PCM-Axius FWC	879288T91

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Page 4 / 5 © 2018 Mercury Marine JULY 2018 2018-01R1

350 MPI ECT 2005-2015

Crate Engine Description	Engine Part Number	Serial Number Range	ECM/PCM Type	ECM/PCM Part Number
			PCM-Alpha	8M0071879
			PCM- Alpha FWC	8M0071878
			PCM-Bravo	8M0072017
		1A300000–1A648622	PCM-Bravo FWC	8M0071880
		1A300000-1A046022	PCM DTS-Bravo	8M0072020
			PCM DTS-Bravo FWC	8M0071885
			PCM-Axius	8M0072023
	0140000550		PCM-Axius FWC	8M0071889
		8M0093550 1A648623–2A446466	PCM-Alpha	8M0059355
350 MPI			PCM-Alpha FWC	8M0059356
2005–2015	01010093550		PCM-Bravo	8M0059357
			PCM-Bravo FWC	8M0059358
			PCM DTS-Bravo	8M0059367
			PCM DTS-Bravo FWC	8M0059368
			PCM-Alpha	8M0099863
			PCM-Alpha FWC	8M0059356
			PCM-Bravo	8M0099866
		2A446467 and up	PCM-Bravo FWC	8M0099868
			PCM DTS-Bravo	8M0099865
			PCM DTS-Bravo FWC	8M0099867

 $\hbox{THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE. } \\$

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

PREDELIVERY INSPECTION—REPOWER

Predelivery Inspection Checklist

Not Applica		Task	Not Applicable	Check/ Adjust	Task
			On-Water To	-	
		Drain plug installed and petcocks closed			Verify MerCathode LED light is on (if equipped)
		Seawater inlet valve open			Engine alignment (inboards only)
		Engine mounts tight			Starter neutral safety switch operation
		Engine alignment			Water pump operation
		Drive unit fasteners torqued			Instruments operation
		Power trim cylinders fasteners tight			Fuel leaks
		Battery fully charged and secured			Oil leaks
		All electrical connections tight			Water leaks
		Exhaust system hose clamps tight			Exhaust leaks
		All fuel connections tight			Ignition timing
		Correct rotation propeller (installed and torqued)			Idle RPM, within specifications
		Throttle, shift, and steering system fasteners tightened properly			Forward - Neutral - Reverse gear operation
		Throttle plates open and close completely			Steering operation throughout range
		Crankcase oil level			Acceleration from idle RPM
		Power trim oil level			WOT RPM within specifications (in forward gear)
		Sterndrive unit oil level			Power trim operation
		Power steering fluid level			Trim tab adjustment/boat handling
		Closed cooling level	After On-Wa	ater Testii	ng:
		Transmission fluid level			Propeller nut torque
		Alternator belt tension			Fuel, oil, coolant, water, and fluid leaks
		Seawater pickup pump belt tension			Oil and fluid levels
		Power assisted steering pump belt tension			Apply Quicksilver Corrosion Guard to engine package
		Audio warning system operation			Verify presence of operation and maintenance manual
					Show customer location of MerCathode controller (See the
_	_	to California residents:			operation manual for light functions)
		CARB hang tag in boat			
		CARB decal properly affixed to boat hull			
		Proposition 65 hang tag in boat	1		
<u> </u>		Component	Serial I	Number, P	art Number, or Invoice Order Number
Original engine serial number (5.0L)					
	Replacement engine serial number (5.7L Crate)				
	Replacement engine invoice order number				
	Original 5	.0L MPI controller part number			
	Replacem	nent MPI controller part number			
	Replacement MPI controller invoice order number				

ECM/PCM Credit Voucher Process

Continental United States and Canada—ECM and PCM Replacement Credit

IMPORTANT: Customers in the continental U.S. and Canada should return items listed below to the appropriate address. All other customers should return parts to their distribution center. The distribution center will return the parts to Mercury Marine.

Items to Return

Please note the information requested in the table below; do not write on the ECM or PCM.

- Copy of the purchase invoice for a 5.7L Quicksilver Crate Engine.
- Copy of 5.7L Quicksilver Crate Motor PDI including table listing serial numbers, part numbers, and invoice order numbers.
- Installation date
- · Original engine ECM or PCM

Send to:

Returns must be sent freight prepaid to the appropriate address as listed below.

Authorized distributors returning products must include the purchase order numbers.

In the Continental United States: In Ca

Mercury Marine Attn.: Return Goods W6250-22A Pioneer Road Fond du Lac. WI 54935 Mercury Marine Canada Attn.: Return Goods 8698 Escarpment Way Milton, Ontario L9T 0M1

Outside the Continental United States and Canada—ECM and PCM Replacement Credit

- 1. Purchase the replacement ECM or PCM through your usual part order channel.
- 2. Preauthorization is required before the claim is submitted to the Marine Power International office or your distributor.
- 3. Submit a warranty claim to the Marine Power International office or your distributor.
- 4. Complete the warranty claim form with the following:
 - · Engine serial number
 - · Date of sale
 - No labor allowed
 - Part Code: 731
 - Code Failure: 40 Fix program