

service bulletin

TO: SERVICE MANAGER PARTS MANAGER


TECHNICIANS

REVISED 5-26-89

No. 89-15

Installation of Dual Engine Console Mount Commander Remote Controls 88688A22, 88688A23 and 88688A24

In some cases the hand grips of the dual engine console mount controls will interfere with each other in the neutral position. This condition can usually be corrected by putting a shim between the two controls using spacer shim part number (15-815547 ordered separately). Attach the self adhesive shim to the aluminum backing plate of one of the controls as shown in the diagram following. Controls must be partially removed from console to install spacer shim.

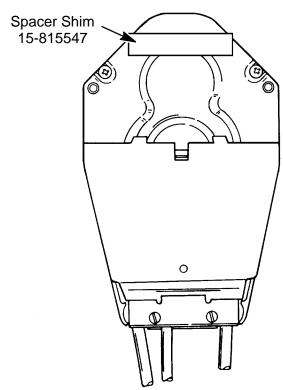

50030

Printed in U.S.A. 89-15 1-689