

Service Bulletin

Bulletin No. 2013-14R1

Circulate to:	Sales Manager	☐ Accounting	Service Manager	Technician	Parts Manager

Propeller Shaft P/N 44-888530 No Longer Available (NLA)

Notice
Revised April 2015. This bulletin supersedes the previous bulletin number 2013-14, October 2013.

Models Affected

Models Covered	Usage		
135/150/175/200 Verado L4			
200/225/250/250 Pro/275/300/300 Pro Verado L6			
200/225/250 EFI 3.0L	Propeller shaft P/N 44-888530 used in gearcases with 4.8 in. diameter torped		
200/225/250 OptiMax 3.0L			
200/225/250 Pro XS DFI 3.0L			

Scope

Worldwide

Situation

The previous propeller shaft part number 44-888530 has been made NLA and must be replaced by ordering a new propeller shaft, new thrust spacer, and shims or shim set as required from the following table. The previous thrust spacer and shim set will continue to be offered to service the part number 44-888530 propeller shaft only.


THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

To Replace a P/N 44-888530 Propeller Shaft You Must Order

Note: A shim set, part number 8M0076745, is available that includes one each of the individual shims listed.

Part Number	Description	Quantity
44-8M0069774	Propeller shaft	1
23-8M0064306	Thrust spacer	1
12-8M0050423 at 2	Shim 0.020 in.	
12-8M0050424 at 2	Shim 0.022 in.	
12-8M0050425 at 2	Shim 0.024 in.	
12-8M0050427 at 2	Shim 0.026 in.	As Required
12-8M0050428 at 2	Shim 0.028 in.	
12-8M0050429 at 2	Shim 0.030 in.	
12-8M0050430 at 2	Shim 0.032 in.	
12-8M0050431 at 2	Shim 0.034 in.	
12-8M0050432 at 2	Shim 0.036 in.	
12-8M0050433 at 2	Shim 0.038 in.	
12-8M0050434 at 2	Shim 0.040 in.	
12-8M0050435 at 2	Shim 0.042 in.	
12-8M0050436 at 2	Shim 0.044 in.	1
12-8M0050437 at 2	Shim 0.046 in.	1
12-8M0050438 at 2	Shim 0.048 in.	1
12-8M0050439 at 2	Shim 0.050 in.	1

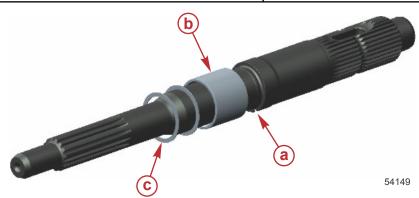

- a Propeller shaft, area of machining change
- **b** Thrust spacer, longer
- c Shims, hardened

 $\textit{THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE. \\$

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Page 2 / 2 © 2015 Mercury Marine APRIL 2015 2013-14R1