

TO: SERVICE MANAGER  MECHANICS   
PARTS MANAGER

91-28

## A. REQUIRED WATER SEPARATING FUEL FILTER REPLACEMENT


### Models Affected

MCM 4.3L Alpha Stern Drive Engine  
Serial Number: OD707436-OD718877

MCM 4.3LX Alpha Stern Drive Engine  
Serial Number: OD707441-OD719830

### Problem

The first type of fuel filter installed on these engines may have the wrong type of metal or weld in it. Refer to Figure 1 for identification. The boat's fuel line is connected on the top of the filter.

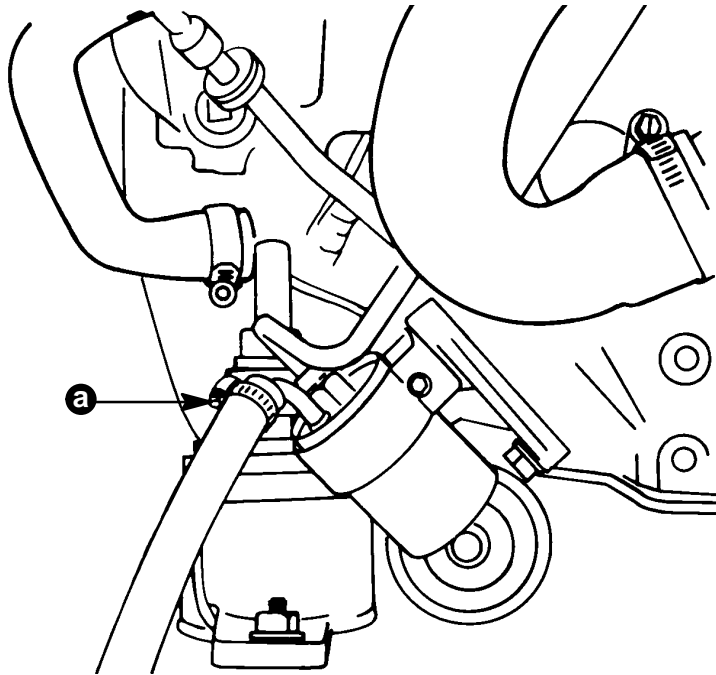


71093

a - Boat's Fuel Line

**Figure 1.**

## Correction

Order a new filter. New filter will have the boat's fuel line connected to the bottom of the filter as shown in Figure 2.

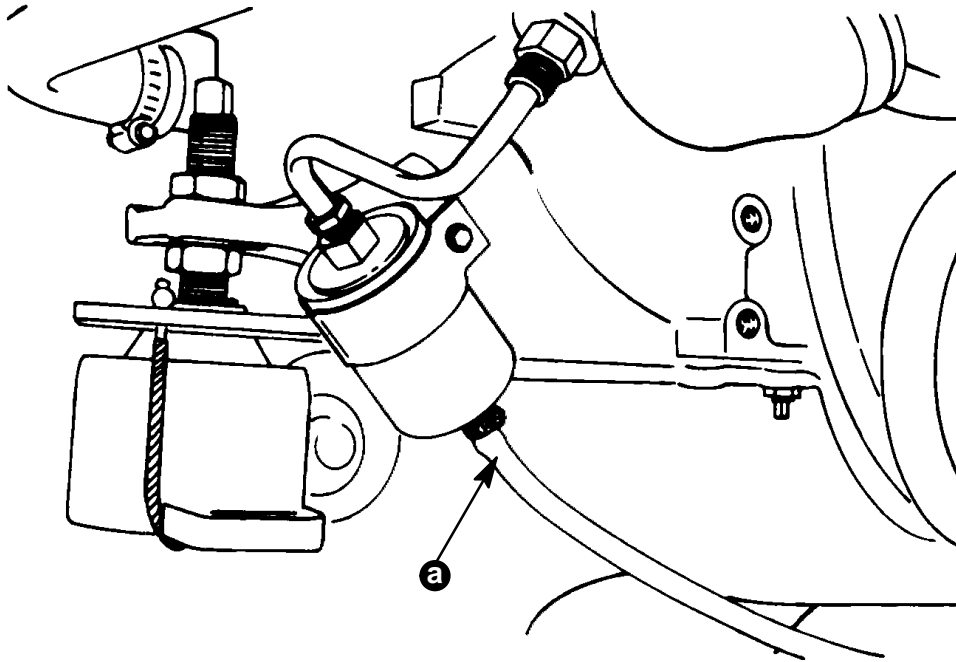

a - Boat's Fuel Line

**Figure 2.**

## Part Required

(1) 35-805031T Fuel Filter

## Warranty

Fill out warranty claim (or campaign card) and send to your normal warranty processing center. More than one engine can be put on a warranty claim if you list the part number, engine model, serial number, and labor hours for each engine on separate lines on warranty claim.

Warranty code: MF90

Labor: 1.0 Hour

Do not return old fuel filters along with warranty claim. Dispose of old filter at your dealership.

71228