

WARRANTY INFORMATION

SERVICE INFORMATION

Bulletin No. 2002-16

PARTS INFORMATION

Circulate to:  Sales Manager  Accounting  Service Manager  Technician  Parts Manager

## Resistor Contact with Steering Cable

### Models Affected

Tour & Tour Edition 36 Volts models manufactured prior to August 1, 2002  
TE7107V, TE7109V, TE7109VP, TR109FB, TR109PFB.

### Situation


The resistor on the circuit board that is marked R34 can come in contact with the steering cable. If this happens, heat from the resistor may cause the insulation around the steering cable to melt, which can lead to electrolysis and/or corrosion.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MOTORGUIDE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by MotorGuide and may not be distributed or copied, digitally or otherwise, without the prior written consent of MotorGuide.

## Correction

When replacing or installing a control board in a Tour or Tour Edition, care must be taken to bend the resistor marked R34 at a 45 degree angle so it does not come in contact with the steering cable housing. Be careful not to bend the resistor too far, causing it to break or become detached from the circuit board. Inspect trolling motors prior to sale and make appropriate corrections as needed.

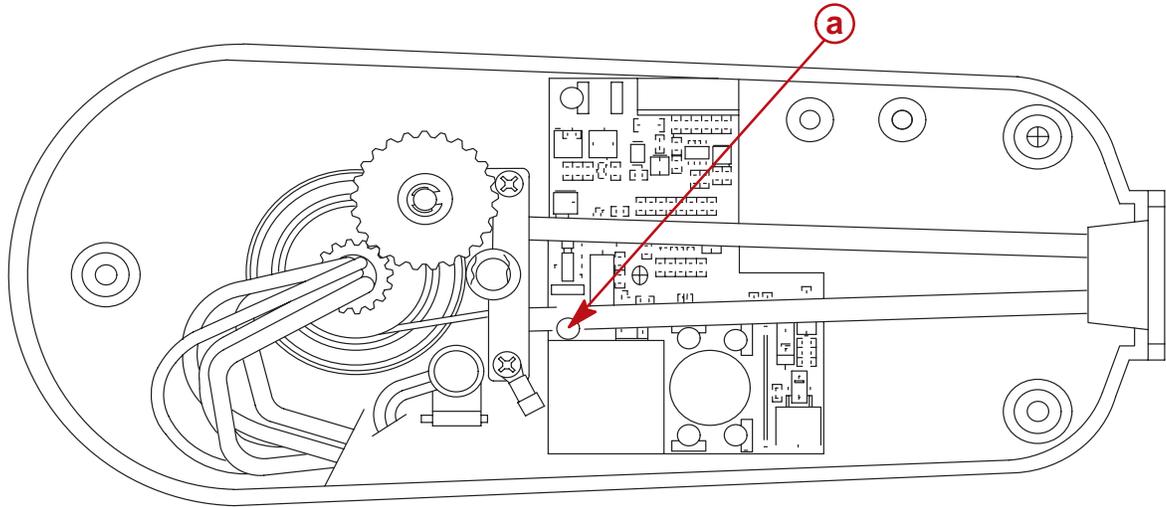

00288

**a** - R34 resistor (Bend at a 45 degree angle)

## Dealer Parts Inventory

When installing circuit boards in Tour and Tour Edition motors, inspect the R34 resistor on the board and apply the correction where applicable. The following circuit boards are used in multiple trolling motor models, the clearance issue is only relative to the Tour and Tour Edition.

MAF15701F  
MAF15712  
MAF15713  
MAF15715  
MAF15716  
MAF15725

## Warranty

- Trolling motor model number and serial number
- Quantity and part numbers of parts used
- Flat Rate Code      SB03      0.3 hour
- Part Code              829
- Failure Code          00

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MOTORGUIDE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by MotorGuide and may not be distributed or copied, digitally or otherwise, without the prior written consent of MotorGuide.