



MERCURY

Precision Parts



No. 2001-4

Power Trim Pump Reservoir Mounting Change

Models

All MCM and Outboards applications having Oildyne Trim Pumps with plastic reservoirs.

Replacement Parts

Our supplier has notified us that they can no longer supply the old reservoir P/N 18525A 1, which is a bottom mount style reservoir. This reservoir was mounted to the adapter by a single threaded screw that is inserted up through the bottom of the reservoir.

The new power trim pumps use a top mount style reservoir. The reservoir is mounted by using the four ears located on the pump adapter. The four screws are threaded down into the top part of the reservoir. The newer style reservoir will provide a tighter mount between the adapter and reservoir.


The old style bottom mount reservoir P/N 18525A 1 will supercede to the top mount reservoir P/N 883166A 2. This new style top mount reservoir will fit power trim pumps that were manufactured after 1991. These pumps have the new style adapters.

If the pump adapter does not have the four mounting ears, Reservoir Update Kit P/N 883169A 1 will need to be ordered. This kit will include the new style adapter and the top mount reservoir.


Parts Required

P/N 883166A 2 Reservoir Assembly. Order if you have new style adapter.

P/N 883169A 1 Reservoir Update Kit. Order if you have old style adapter.

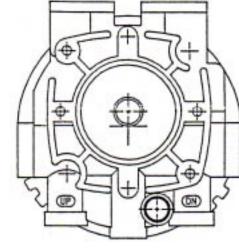

Old Style Adapter

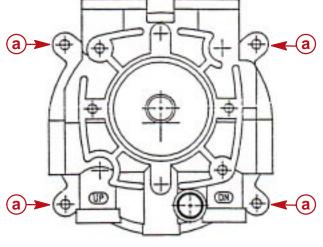

New Style Adapter a - Mounting ears